
Insert Selection Guide

Material Group	Light Machining (Light geometry)		General Purpose		Heavy Machining (Strong geometry)	
	wear resistance		←	→	toughness	
	Geometry	Grade	Geometry	Grade	Geometry	Grade
P1–P2	.E..GE	KCPM40	**.S..GE**	**KCPM40**	.S..GEM	KCPM40
P3–P4	.E..GE	KCPM40	**.S..GE**	**KCPM40**	.S..GEM	KCPM40
P5–P6	.E..GE	KC725M	**.S..GE**	**KC725M**	.S..GEM	KCPM40
M1–M2	.E..GE	KCSM40	**.S..GE**	**KCSM40**	.S..GEM	KC522M
M3	.E..GE	KCPM40	**.S..GE**	**KCPM40**	.S..GEM	KCPM40
K1–K2	.S..GE	KC520M	**.S..GE**	**KCK15**	.S..GEM	KCK15
K3	.S..GE	KC520M	**.S..GE**	**KCK15**	.S..GEM	KC520M
N1–N2	.E..LEJ	KC422M	**.E..LEJ**	**KC422M**	.E..LEJ	KC422M
N3	.E..LEJ	KC422M	**.E..LEJ**	**KC422M**	.E..LEJ	KC422M
S1–S2	.E..GE	KCSM40	**.S..GE**	**KC725M**	.S..GE	KCSM40
S3	.E..GE	KCSM40	**.S..GE**	**KCSM40**	.S..GE	KCSM40
S4	.E..GE	KCSM40	**.S..GE**	**KCSM40**	.S..GE	KCSM40
H1	–	–	**–**	**–**	–	–

Indexable Inserts • Mill 4-11


LNGU11-ELEJ

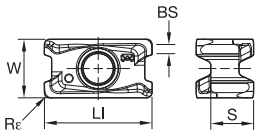

LNGU11-ELEJ

● first choice
○ alternate choice


		KC422M	KC520M	KC522M	KC725M	KCK15	KCPK30	KCPM40	KCSM30	KCSM40
P				○	●		●	●		○
M				●	●		○	●	○	●
K			●	○		●	○			
N		●								
S				●	●			○	●	●
H										

LNGU11-ELEJ • For Aluminium and Other Non-Ferrous Alloys

catalogue number	LI	S	W	BS	Rε	hm	cutting edges	KC422M	KC520M	KC522M	KC725M	KCK15	KCPK30	KCPM40	KCSM30	KCSM40
LNGU110404ERLEJ	12,16	4,83	6,60	1,40	0,4	0,04	4	●	–	–	–	–	–	–	–	–
LNGU110408ERLEJ	12,16	4,83	6,60	1,00	0,8	0,04	4	●	–	–	–	–	–	–	–	–

- -EGE is the first choice for stainless steel and high-temp alloys.
- Use -EGE geometry for the highest finishing requirements, in light machining, for all materials.


LNGU11-EGE

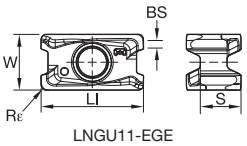

LNGU11-EGE

LNGU11-EGE • Precision Ground • For Stainless Steel and High-Temp Alloys


catalogue number	LI	S	W	BS	Rε	hm	cutting edges	KC422M	KC520M	KC522M	KC725M	KCK15	KCPK30	KCPM40	KCSM30	KCSM40
LNGU110404ERGE	12,16	4,83	6,60	1,40	0,4	0,08	4	–	–	●	●	–	–	●	–	–
LNGU110408ERGE	12,16	4,83	6,60	1,00	0,8	0,08	4	–	–	●	●	–	–	●	●	●
LNGU110412ERGE	12,17	4,83	6,60	0,60	1,2	0,08	4	–	–	●	–	–	–	●	–	●

- -SGE is the universal geometry for Mill 4-11. First choice when machining steel, as well as stainless steel, and high-temp alloys in heavy applications.
- Precision ground insert results in a great versatility for both roughing and finishing operations.

● first choice
○ alternate choice

P			○	●		●	●		○
M			●	●		○	●	○	●
K		●	○		●	○			
N	●								
S			●	●			○	●	●
H									


LNGU11-SGE

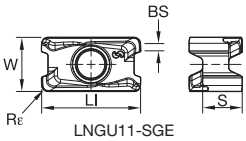


LNGU11-SGE

LNGU11-SGE • Precision Ground • Universal Geometry • General Purpose for Roughing and Finishing Operations

catalogue number	LI	S	W	BS	Rε	hm	cutting edges	KC422M	KC520M	KC522M	KC725M	KCK15	KCPK30	KCPM40	KCSM30	KCSM40
LNGU110404SRGE	12,16	4,83	6,60	1,40	0,4	0,10	4	–	–	●	–	–	–	●	–	●
LNGU110408SRGE	12,16	4,83	6,60	1,00	0,8	0,10	4	–	–	●	●	●	●	●	–	●

- -SGE is the universal geometry for Mill 4-11. First choice when machining steel, as well as stainless steel and high-temp alloys in heavy applications.
- Precision-pressed insert is a perfect choice for roughing operations with a better cost per edge and great surface quality.


LNPU11-SGE

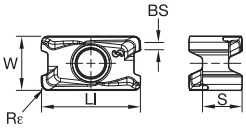


LNPU11-SGE

LNPU11-SGE • Precision Pressed • General Purpose for Roughing and Semi-Finishing Operations

catalogue number	LI	S	W	BS	Rε	hm	cutting edges	KC422M	KC520M	KC522M	KC725M	KCK15	KCPK30	KCPM40	KCSM30	KCSM40
LNPU110408SRGE	12,10	4,83	6,60	0,90	0,8	0,10	4	–	●	●	●	●	●	●	–	–
LNPU110412SRGE	12,10	4,83	6,60	0,50	1,2	0,10	4	–	●	●	●	●	●	●	–	–
LNPU110416SRGE	12,10	4,83	6,60	0,02	1,6	0,10	4	–	●	●	●	–	●	●	–	–

- -SGEM geometry is the first choice for cast iron machining in medium and heavy applications.
- -M stands for margins, which are used to reinforce the geometry.


LNGU11-SGEM

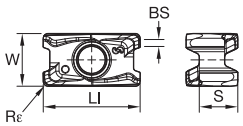

LNGU11-SGEM

LNGU11-SGEM • Precision Ground • For Cast Iron and Heavy Applications

catalogue number	LI	S	W	BS	Rε	hm	cutting edges	KC422M	KC520M	KC522M	KC725M	KCK15	KCPK30	KCPM40	KCSM30	KCSM40
LNGU110408SRGEM	12,16	4,83	6,60	0,90	0,8	0,10	4	–	●	●	–	●	●	●	–	–
LNGU110412SRGEM	12,16	4,83	6,60	0,60	1,2	0,10	4	–	●	–	–	●	●	●	–	–
LNGU110416SRGEM	12,16	4,83	6,60	0,10	1,6	0,10	4	–	●	–	–	●	●	●	–	–

Recommended Starting Feeds [mm]

Light Machining	General Purpose	Heavy Machining

Insert Geometry	Recommended Starting Feed per Tooth (Fz) in Relation to % of Radial Engagement (ae)															Insert Geometry
	5%			10%			20%			30%			40–100%			
.E..LEJ	0,13	**0,35**	0,58	0,09	**0,25**	0,42	0,07	**0,19**	0,31	0,06	**0,17**	0,27	0,06	**0,15**	0,25	.E..LEJ
.E..GE	0,23	**0,43**	0,59	0,17	**0,31**	0,43	0,13	**0,23**	0,32	0,11	**0,20**	0,28	0,10	**0,18**	0,25	.E..GE
.S..GE	0,23	**0,46**	0,65	0,17	**0,33**	0,47	0,13	**0,25**	0,35	0,11	**0,22**	0,31	0,10	**0,20**	0,28	.S..GE
.S..GEM	0,23	**0,46**	0,71	0,17	**0,33**	0,51	0,13	**0,25**	0,38	0,11	**0,22**	0,33	0,10	**0,20**	0,30	.S..GEM

NOTE: Use “Light Machining” values as starting feed rate.
Please see pages X22–X37 for recommended starting speeds.

Looking for a product that’s not shown in this catalogue?

Check the Kennametal website!

Online product catalogue available 24/7

Visit **kennametal.com/IndexableMilling** to browse our electronic catalogue any time you’re looking for the best Kennametal tooling solutions.

It’s fast, free, and always available. The online e-catalogue is updated weekly with products and solutions for milling, turning, holemaking, and tooling systems applications.

